





















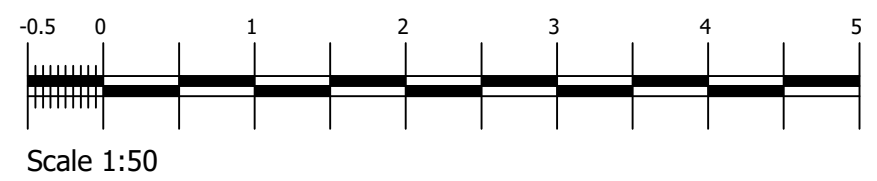


Legend: Deterioration Mapping (Based on ICOMOS - ISCS Illustrated Glossary 2008)

Crack & Deformation		Detachment		Features Induced By Material Loss		Discoloration & Deposit				Others		Back Weathering											
	Crack		Biological Colonisation		Blistering		Disintegration including Powdering		Alveolisation		Missing Part		Crust		Efflorescence		Graffiti		Rust Staining		Metal Inserts		Cement Rendering
	Deformation		Higher Plants		Delamination including Exfoliation		Erosion including Differential Erosion		Mechanical Damage		Deposit		Encrustation		Patina		Accretions		Paint				



NOTES:

Atelier Periti
Conservation, Architecture and Civil Engineering
Chantal, 5 Zammit Hammet Street Balzan
Tel: 7942 9875

THIS DRAWING REMAINS THE PROPERTY OF ATELIER PERITI
AND MUST NOT BE USED OR COPIED WITHOUT WRITTEN PERMISSION.

TITLE
EXISTING DETERIORATION
OF THE PORCH MAIN WALL
(ELEVATION 04) AND CEILING

JOB
PROPOSED RESTORATION
OF THE MAIN FACADE OF THE
FLORIANA PARISH CHURCH

PROJECT ARCH	M.A.	LOC. NO	--
CHECKED	--	CAD REFERENCE	--
DRAWN BY	--	DRAWING NO.	--
SCALE	1:50		
DATE	04/08/2021		
JOB NO	315/20		