




NOTES:

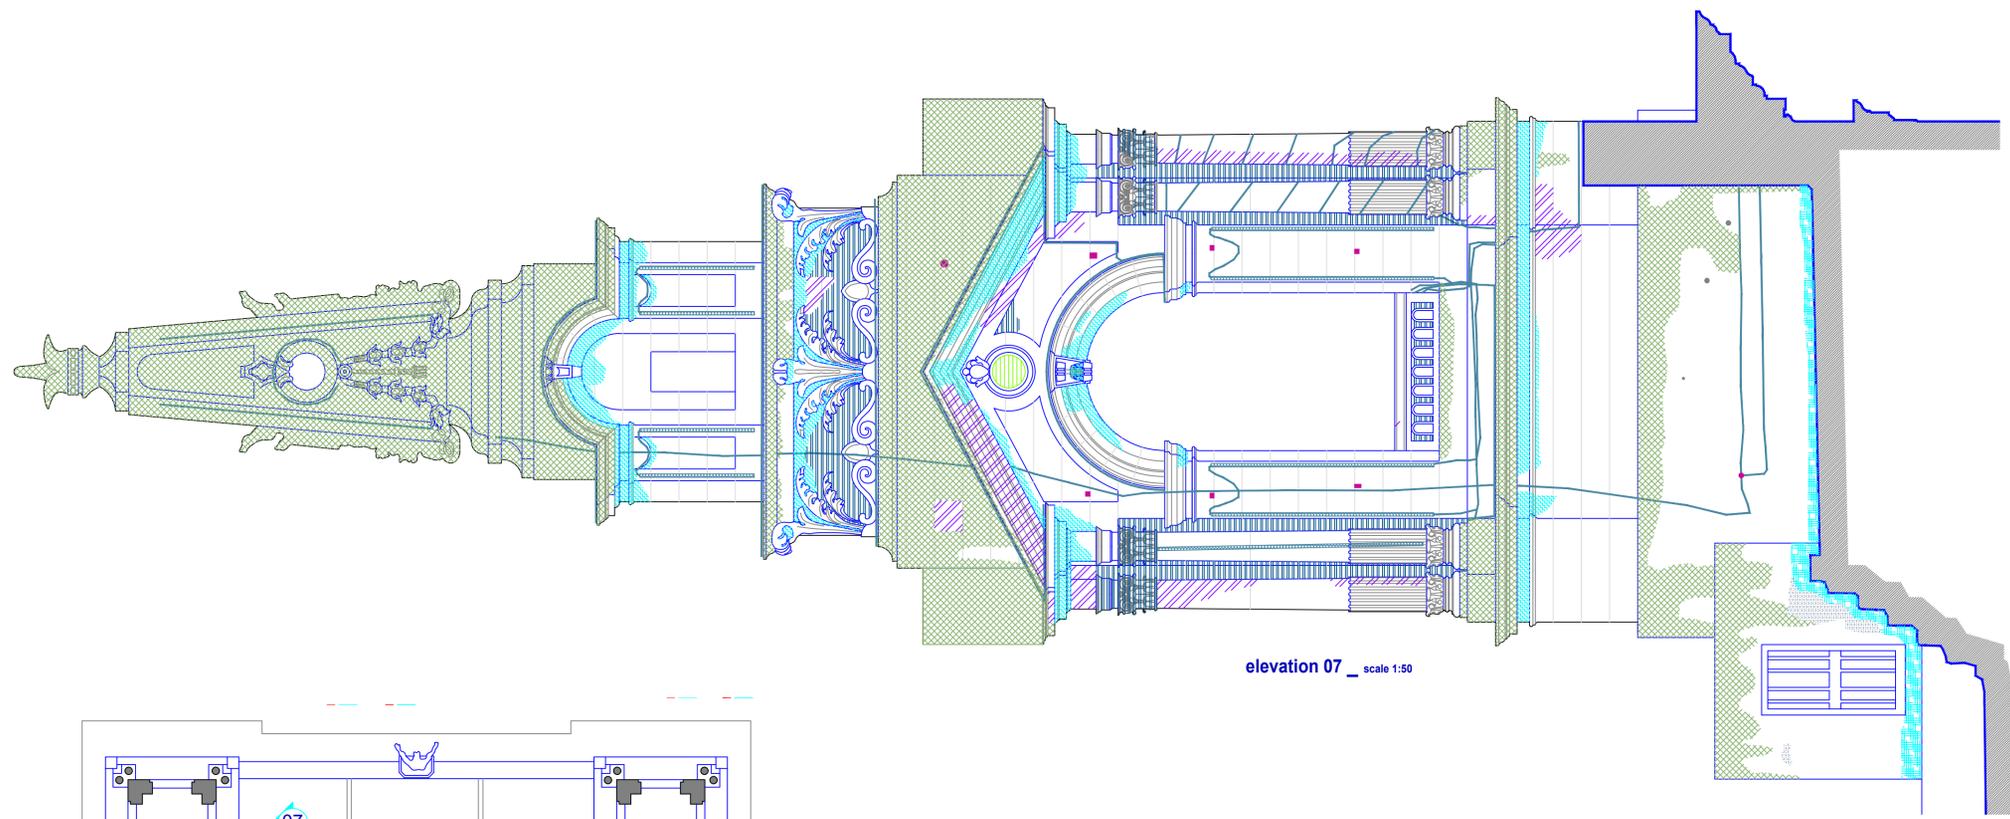

elevation 07 _ scale 1:50

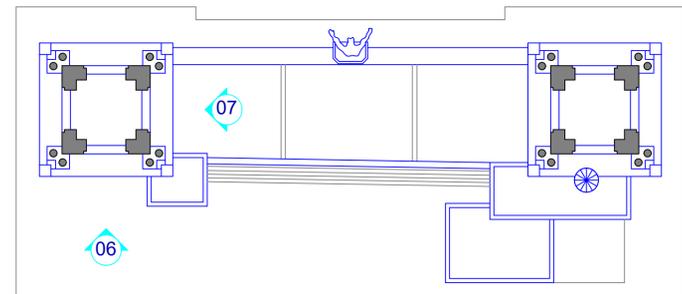


part plan of roof _ scale 1:200

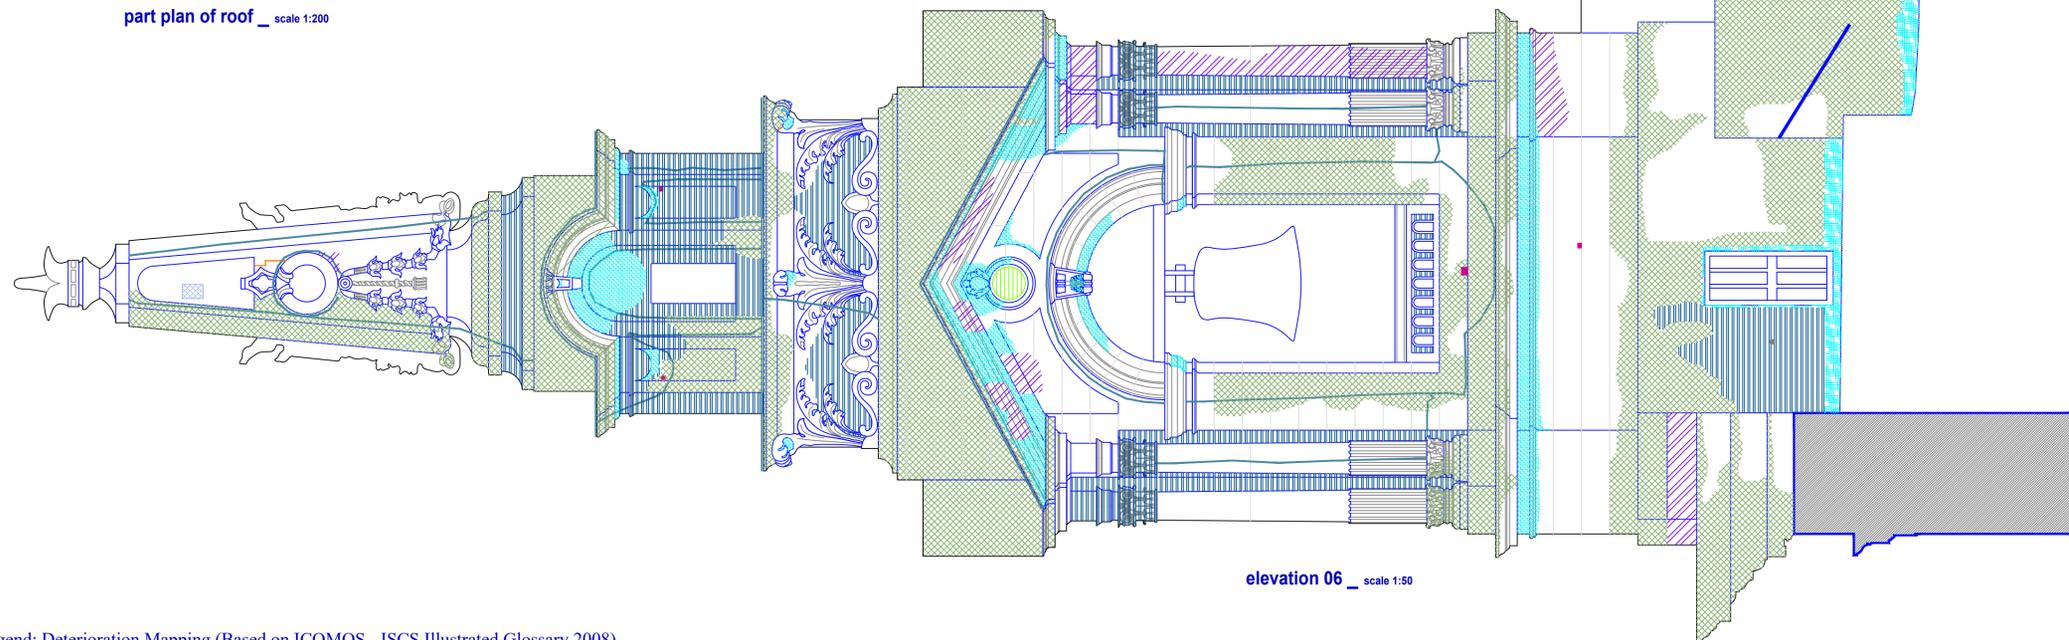

elevation 06 _ scale 1:50

Legend: Deterioration Mapping (Based on ICOMOS - ISCS Illustrated Glossary 2008)

Crack & Deformation Crack Deformation	Biological Colonisation Biological Colonisation Higher Plants	Detachment Blistering Delamination including Exfoliation	Disintegration including Powdering Disintegration including Powdering Detachment	Features Induced By Material Loss Alveolisation Erosion including Differential Erosion Missing Part Mechanical Damage	Discoloration & Deposit Crust Deposit Efflorescence Encrustation Graffiti Patina Rust Staining	Others Metal Inserts Accretions Back Weathering Cement Rendering
--	--	---	---	--	--	---



REVISION MARK	-								
Atelier Periti Conservation, Architecture and Civil Engineering Chantal, 5 Zammit Hammet Street Balzan Tel: 7942 9875									
<small>THIS DRAWING REMAINS THE PROPERTY OF ATELIER PERITI AND MUST NOT BE USED OR COPIED WITHOUT WRITTEN PERMISSION.</small>									
TITLE EXISTING DETERIORATION OF THE NORTH BELFRY (ELEVATIONS 06 AND 07)									
JOB PROPOSED RESTORATION OF THE MAIN FACADE OF THE FLORIANA PARISH CHURCH									
PROJECT ARCH	M.A.	LOC. NO	-						
CHECKED	-	CAD REFERENCE	-						
DRAWN BY	-								
SCALE	1:50	DRAWING NO.	315/20						
DATE	04/08/2021	DRAWING NO.	315/20/16						
JOB NO	315/20								