


elevation 10 \_ scale 1:50

part plan of roof \_ scale 1:200

elevation 09 \_ scale 1:50

Legend: Deterioration Mapping (Based on ICOMOS - ISCS Illustrated Glossary 2008)

|                                |             |                   |                                    |  |  |                                    |               |               |                  |
|--------------------------------|-------------|-------------------|------------------------------------|--|--|------------------------------------|---------------|---------------|------------------|
| <b>Crack &amp; Deformation</b> |             | <b>Detachment</b> |                                    | <b>Features Induced By Material Loss</b> |  | <b>Discoloration &amp; Deposit</b> |               | <b>Others</b> |                  |
|                                | Crack       |                   | Biological Colonisation            |  | Alveolisation                          |                                    | Crust         |               | Metal Inserts    |
|                                | Deformation |                   | Higher Plants                      |  | Missing Part                           |                                    | Efflorescence |               | Accretions       |
|                                |             |                   | Blistering                         |  | Erosion including Differential Erosion |                                    | Encrustation  |               | Back Weathering  |
|                                |             |                   | Delamination including Exfoliation |  | Mechanical Damage                      |                                    | Graffiti      |               | Cement Rendering |
|                                |             |                   | Disintegration including Powdering |  | Rust Staining                          |                                    | Patina        |               |                  |

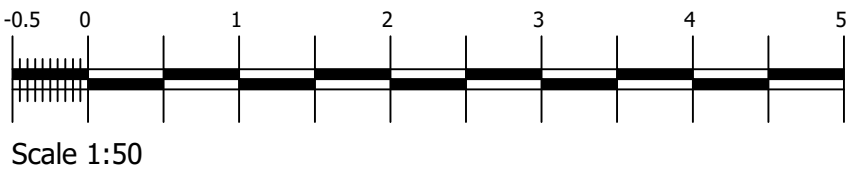

NOTES:

Atelier Periti  
Conservation, Architecture and Civil Engineering  
Chantal, 5 Zammit Hammet Street Balzan  
Tel: 7942 9875

TITLE  
EXISTING DETERIORATION  
OF THE SOUTH BELFRY  
(ELEVATIONS 09 AND 10)

JOB  
PROPOSED RESTORATION  
OF THE MAIN FACADE OF THE  
FLORIANA PARISH CHURCH

|              |            |               |           |
|--------------|------------|---------------|-----------|
| PROJECT ARCH | M.A.       | LOC. NO       | --        |
| CHECKED      | --         | CAD REFERENCE | --        |
| DRAWN BY     | --         |               |           |
| SCALE        | 1:50       | DRAWING NO.   | 315/20/18 |
| DATE         | 20/08/2021 |               |           |
| JOB NO       | 315/20     |               |           |