




















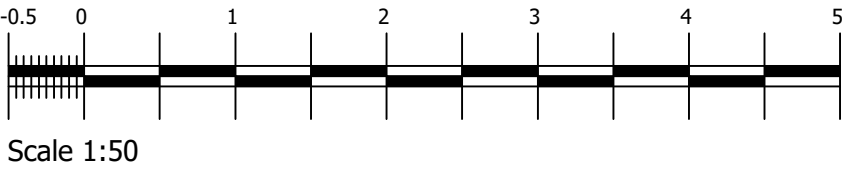


elevation 05\_ scale 1:50

Legend: Deterioration Mapping (Based on ICOMOS - ISCS Illustrated Glossary 2008)

Crack & Deformation		Detachment		Features Induced By Material Loss		Discoloration & Deposit		Others	
	Crack		Biological Colonisation		Blistering		Alveolisation		Metal Inserts
	Deformation		Higher Plants		Disintegration including Powdering		Crust		Accretions
					Delamination including Exfoliation		Efflorescence		Back Weathering
					Mechanical Damage		Graffiti		Cement Rendering
					Erosion including Differential Erosion		Encrustation		
					Missing Part		Patina		
							Rust Staining		



NOTES:

REVISION MARK | - | | | | | | | | | | | | | |

Atelier Periti

Conservation, Architecture and Civil Engineering

Chantal, 5 Zammit Hammet Street Balzan

Tel: 7942 9875

THIS DRAWING REMAINS THE PROPERTY OF ATIELER PERITI  
AND MUST NOT BE USED OR COPIED WITHOUT WRITTEN PERMISSION.

TITLE

EXISTING DETERIORATION  
OF THE PORCH COLUMNS  
(ELEVATION 05)

JOB

PROPOSED RESTORATION  
OF THE MAIN FACADE OF THE  
FLORIANA PARISH CHURCH

PROJECT ARCH

CHECKED

DRAWN BY

SCALE

DATE

JOB NO

M.A.

...

...

1:50

04/08/2021

315/20

LOC. NO

CAD REFERENCE

DRAWING NO.

-

-

315/20/15